



Informations techniques/Technical Matters

Industries Bouchard, Inc.

FILIALE - SUBSIDIARY
GIFER RECREATIONLa Pocatière, P.Q., Canada
code 418 tél: 856-1232
téléc: 011-3486

July 2nd 1970

DATE _____

Re: CAPRI 1971

On the 1971 Capri model prior to serial # 1B2J5271, the steering handle bar may stop too close to the windshield trim.

Proceed as follow on unit affected:


Disconnect the tie rod from the steering arms and drill a 3/8" hole in the steering arms centered at 1/2" forward from the center of the existing hole.

Reconnect the tie rod in this new position.


Time allowed: \$1.50

Operation # 49.002

This number must appear on the warranty claims.

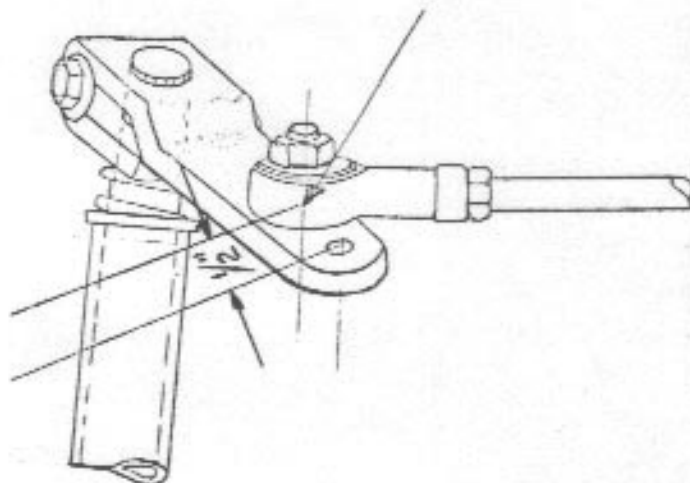

YA: ro


Y. Arpin
Director of After Sales