



Informations techniques / Technical Matters

DATE June 7, 1971.SUBJECT: UPPER ATTACHMENT BRACKET OF THE HANDLE BAR (MOTO-SKEETER).

On all Moto-Skeeter, the attachment of the handle bar to the telescopic fork has to be strengthened. To reinforce this part of the steering, the handle bar upper brackets (no.21.00.15) have to be changed.

PARTS NEEDED

The upper brackets needed to complete this modification are now available, free of charge, from your distributor (under the part number 21.00.15).

MODIFICATION PROCEDURE.

1. Remove the 4 cap screws (use a wrench 7/16") from the 2 upper brackets.
2. Replace the 2 upper brackets by the new ones.
3. Tighten the 4 hex. head cap screws to 5 ft. lbs.
4. Move back and forth * (3 to 4 times) the handle bar.

* This operation will permit a better seating of the handle bar into the brackets.

5. Finally torque the 4 cap screws to 8 - 10 ft. lbs.

NOTE: No labour time is allowed to do this modification. It is not necessary to complete a warranty claim form since no time is allowed and the parts are supplied free of charge.