

**Informations techniques / Technical Matters**DATE October 27th, 1971.SUBJECT: REMOVAL OF CHOKE LEVER SCREW.RE: TILLOTSON CARBURETOR HR44A ON 1972 CAPRI 292.INCIDENT

The choke lever screw on the carburetor (Tillotson HR44A used on 1972 Capri 292) is normally removed during the pre-assembly of engine components (production line).

On some units, the choke lever screw has not been removed.

POSSIBLE EFFECT

The choke lever cable drum could rotate, causing the head of the choke lever screw to contact the throttle bracket, therefore restricting the throttle action.

REMEDY

During pre-delivery inspection, make sure that the choke lever screw has been removed.

If not, remove and discard.

RL/lb

Technical Information Department.