

**Informations techniques/Technical Matters****Industries Bouchard, Inc.**

La Pocatière, P.Q. Canada
code 418 tél.: 856-1232
téléc.: 011 3486

DATE July 10 1970Re: 1970 Mini-Sno

On the 1970 Mini-Sno models, the engine cover seems to produce an overheating condition.

In order to increase the flow of air under the cover to keep the carburation at a permitted temperature for proper operation, a kit containing vent grills, return line, elbow fitting as well as a spacer for the carburator is available through regular channels.

A diagram is included to provide the information concerning the location where the vent grills are to be mounted.

The return line elbow must be installed at a angle of thirty degrees (30°) upwards with the line going over the carburator, coming down under the engine and hooked up to a two way fitting provided for the tank.


The insulator block contained in the kit will provide, when installed between the motor and the carburator, a sufficient control of the heat transferring from the motor to the carburator.

The part kit is available under no: IL-1001

Labor allowance: \$2.00 plus parts.

This operation will carry the number STO 90.004 special technical operation and this reference has to appear on all warranty claims submitted.

YA: ro


Y. Arpin
Director of After Sales

TM/70-04



T




70-04

Industries Bouchard, Inc.

FIAMMILIA SIBSIDIARY
GIFFEN RECREATION

La Pocatiere, P.Q., Canada
code 418 tél: 856-1232
téléc: 011-3486

DATE Le 10 juillet 1970

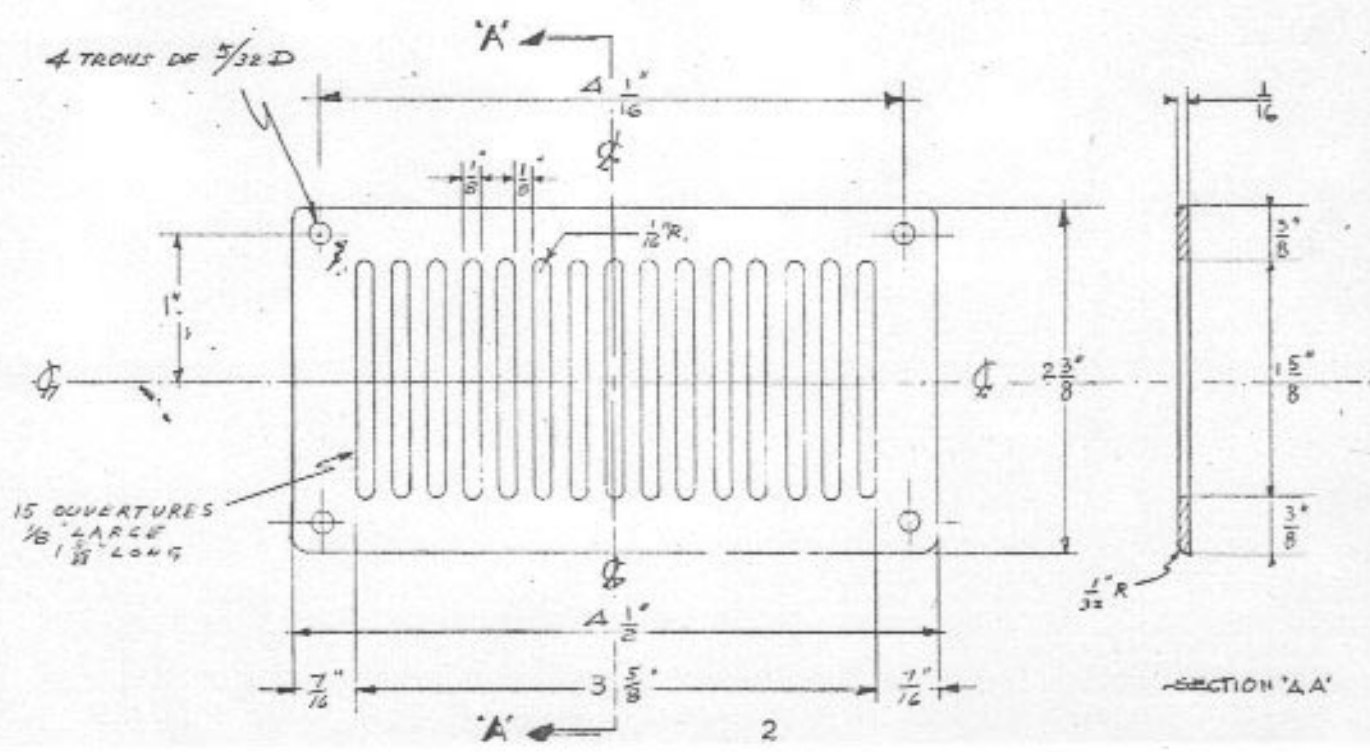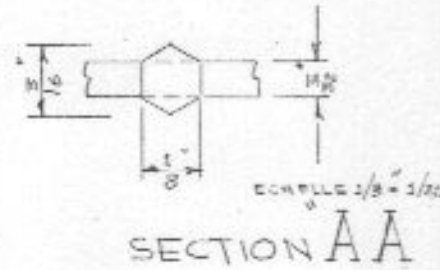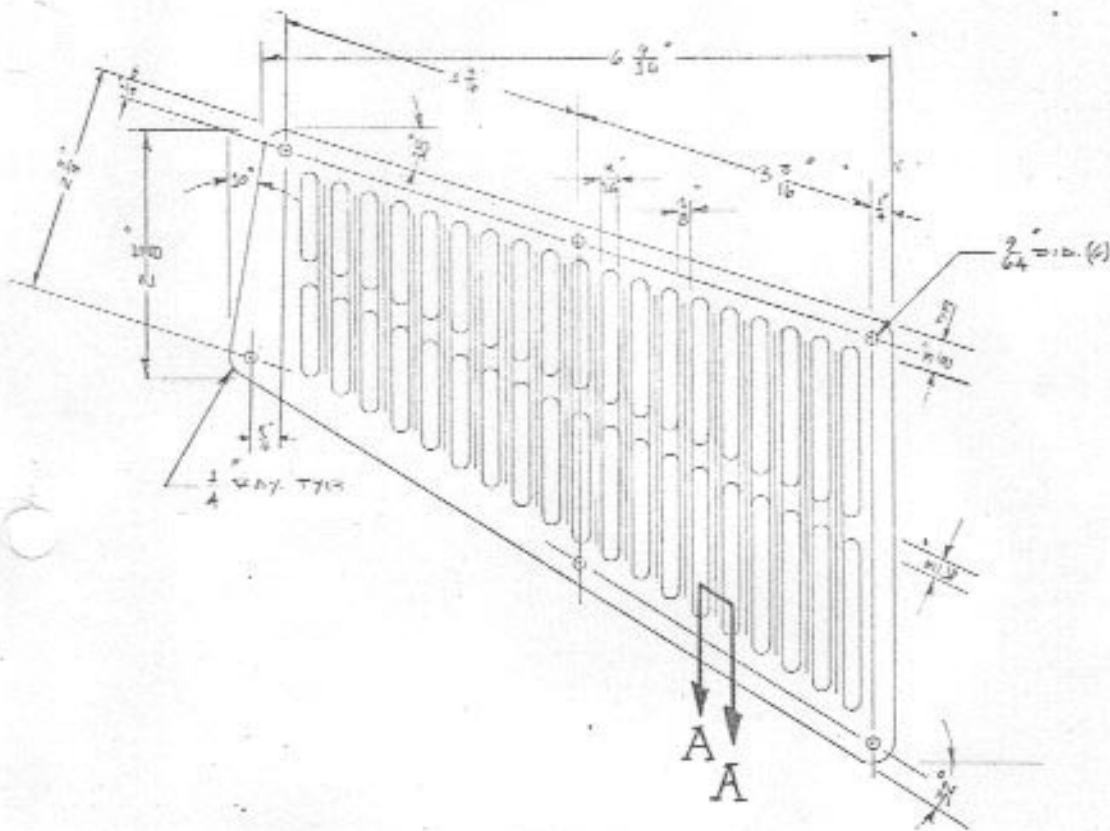



T

70-04



Industries Bouchard, Inc.

FILIALE - SUCCURSALE La Pocatière, P.Q., Canada
GIFPEN RECREATION code 418 tél.: 856-1232
téléx: 011-3486

July 10 1970

DATE _____

3

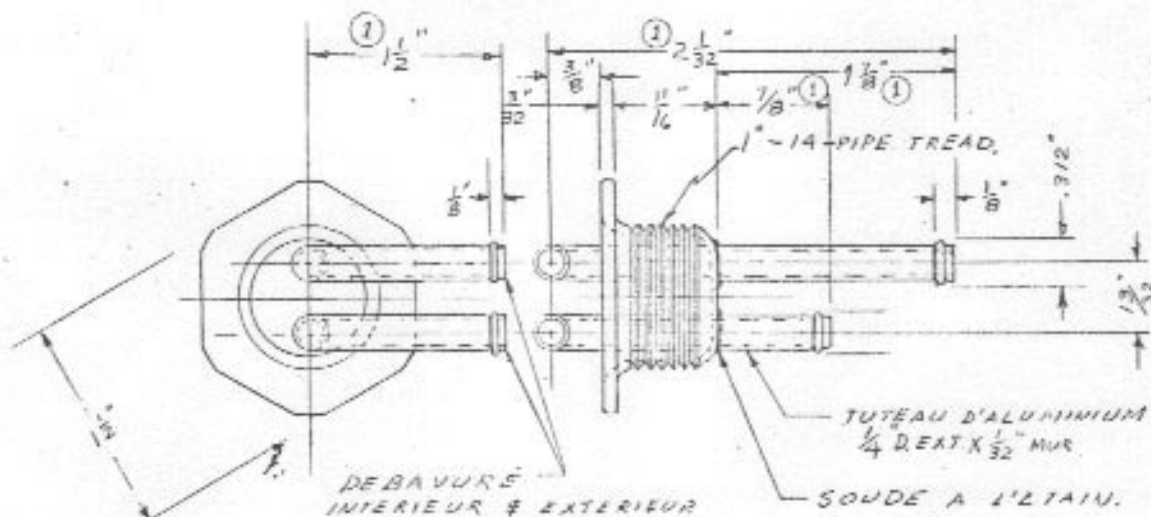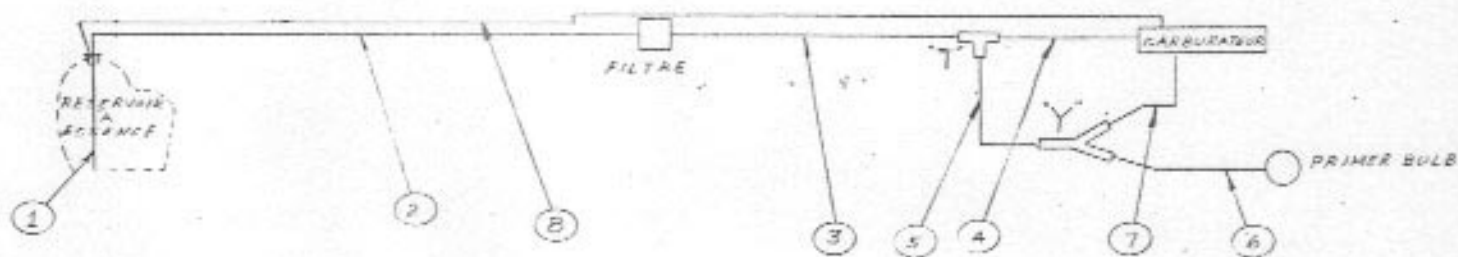

4