

**Informations techniques / Technical Matters****Industries Bouchard, Inc.**

La Pocatière, P.Q. Canada
code 418 tel.: 856-1232
téléc.: 011-3486

DATE December 21, 1970.

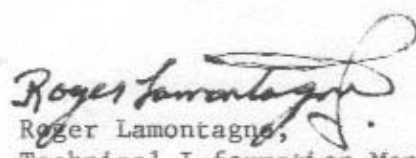
SUBJECT: 1971 IDLE SPEED ADJUSTER SCREW (Tillotson carburetors)

A slight modification is needed to prevent accidental blocking of the throttle in open position and also to prevent the rubbing of the lower portion of the throttle cable against the roll pin of the idle speed adjuster screw.

MODIFICATION PROCEDURE.

1. Unscrew and remove the idle speed adjuster screw from the carburetor.
2. With a diagonal cutter plier extract the roll pin from the adjuster screw
3. Without the roll pin reinstall the idle speed adjuster screw on the carburetor.

NOTE: No labor time is allowed for this modification.


Roger Lamontagne,
Technical Information Manager.

PRINTED IN CANADA

Imp. Fortin Ltée, La Pocatière